

# Technical Bulletin

Model  
911C2/C4

Group  
2

**Subject:** Cruise Control Diagnosis

Part Identifier  
2780

Number  
9004


**ATTENTION: Service Manager/Service Technician**

**Models Affected:** *911 Carrera 2/4*

**Concern:** A loose or misadjusted clutch pedal switch may cause the cruise control to become inoperative.

**Repair Information:** The clutch pedal microswitch circuit **should open** with clutch pedal depressed  $15 \pm 2\text{mm}$  (audible click). If necessary, loosen switch mounting screws and adjust switch. Make sure mounting screws are tight after adjusting or when checking switch.

**Labor Information:** Labor Operation: 27 80 19 0A  
Time Units: 50

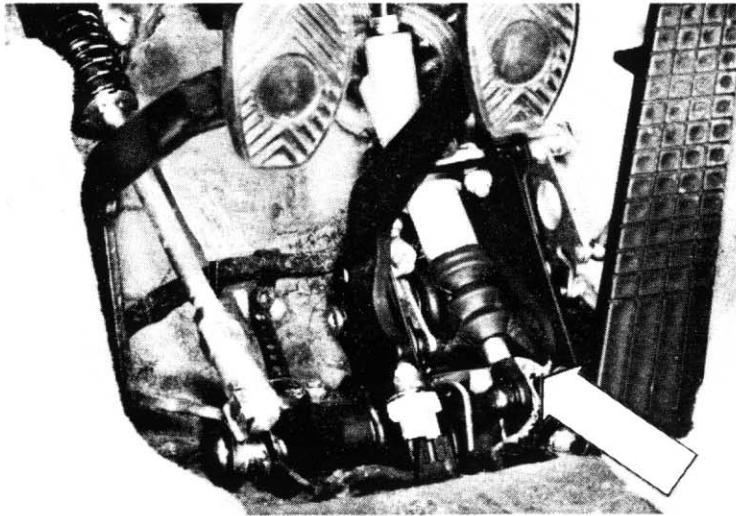

PORSCHE CARS NORTH AMERICA INC.

Dealership \_\_\_\_\_ Service manager \_\_\_\_\_ Shop foreman \_\_\_\_\_ Service technician \_\_\_\_\_  
Distribution \_\_\_\_\_  
Routing \_\_\_\_\_ Asst. manager \_\_\_\_\_ Warranty admin. \_\_\_\_\_ Service technician \_\_\_\_\_

©1990 Porsche Cars  
North America, Inc.  
All Rights Reserved  
Technical Support  
Department



# SERVICE

Page 1 of 1  
March 23, 1990